



## Electromagnetic Field Measurement Survey



**BS Number: 35**

**Site Name: Mochudi Police**

**Site Address:**

Mochudi Extension Police Station

Along A13

Mochudi

**Site visit date: 28 October 2010**

**Site report date: 01 December 2010**

## Introduction

As part of an electromagnetic measurement survey program of base station installations performed by the Botswana Telecommunications Authority (BTA), measurements were performed at Mochudi Police. The aim of the survey was to measure the electromagnetic exposure levels at various positions around the base station.

Measured results are compared to the guidelines of limiting exposure proposed by the International Commission on Non-Ionizing Radiation Protection (ICNIRP).

## Measured Results


Table 1 and Figure 1 presents the measured positions and exposure levels in terms of a percentage of the ICNIRP guidelines, where a 100% value would indicate that the safe exposure limit for the General Public has been reached. The total exposure is given in the first column of the table. Since the aim of the survey was to measure the typical exposure values, the reported results are un-extrapolated peak field instantaneous exposure results, at the specific date and time of the measurement survey.

## Summary of Results & Conclusion

For the measured results presented in this report a 100% value would indicate that the ICNIRP exposure limit for the General Public has been reached. The highest value measured is 0.0180% of the ICNIRP General Public guidelines and was obtained at position 5. This is more than 5540 times below the General Public limit.

**Table 1: RF Exposure Levels at Measurement Positions**

Measured On	No.	Position	Total Exposure	GSM900 DL	GSM1800 DL	UMTS DL	Others
2010/10/28 16:23	1	At the base of the Mochudi Police Station mast.	0.0026%	0.0001%	0.0000%	0.0000%	0.0025%
2010/10/28 16:29	2	At the impound lot of the Mochudi Police station.	0.0042%	0.0001%	0.0000%	0.0000%	0.0041%
2010/10/28 16:34	3	In the reception of the Mochudi Police Station.	0.0083%	0.0002%	0.0000%	0.0000%	0.0081%
2010/10/28 16:38	4	In the Radio Control Room on the second floor of the Mochudi Police Station.	0.0023%	0.0001%	0.0000%	0.0000%	0.0023%
2010/10/28 16:44	5	Across the A13 from the Mochudi Police Station, close to the road leading to the Mochudi Methodist Church.	0.0180%	0.0001%	0.0000%	0.0000%	0.0180%
2010/10/28 16:50	6	Along the fence of the Accountant General's offices.	0.0030%	0.0008%	0.0000%	0.0000%	0.0022%

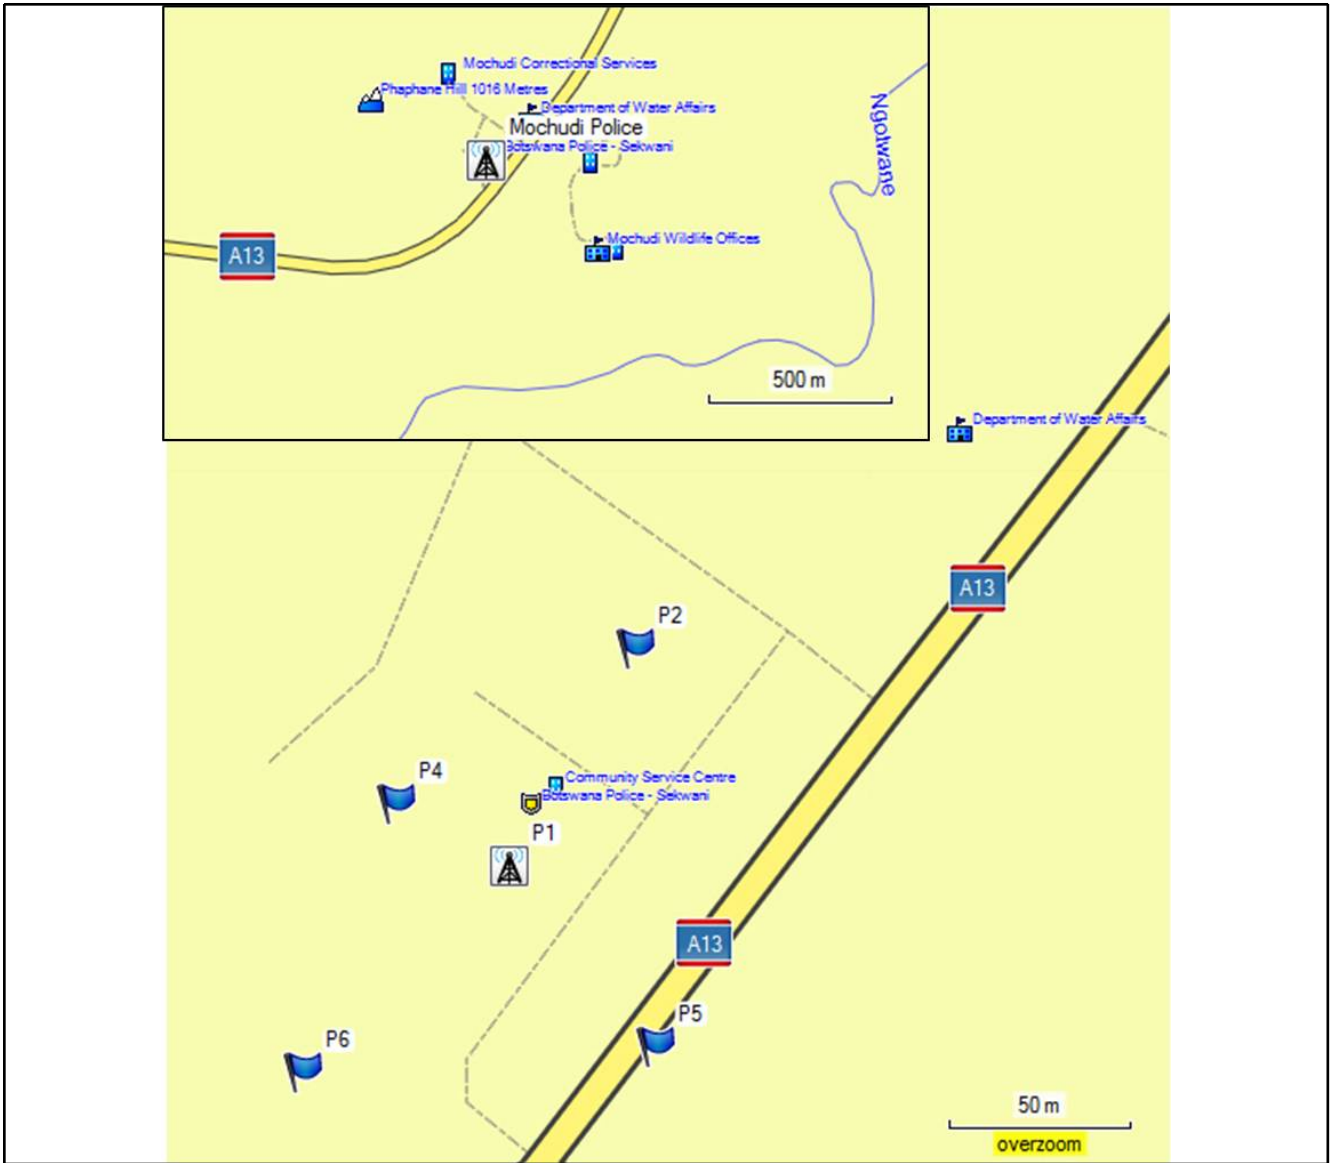

**Figure 1: Map of Area around Base Station Site and Measurement Positions**

## Measurement Equipment and Methodology

Both survey meter and probe must be calibrated on a regular basis. The calibration status is presented in the following table.

<b>Survey Meter:</b>	Narda SRM 3006 Selective Radiation Meter, S/N: D-0016	<b>Calibration Status:</b>	Valid calibration: 12 July 2010
<b>Probe:</b>	Narda BN 3501 Three-Axis E-Field Probe, S/N: K-0195	<b>Calibration Status:</b>	Valid calibration: 24 June 2010

## Assessment Process and Software

The assessment process, software and training were developed by EMSS Consulting (EMSS). EMSS has expertise in the field of human exposure assessment to radio-frequency fields.

BTA engineers were trained by EMSS to perform measurements in accordance with the measurement protocol of the CENELEC 50492 (November 2008) standard for the in-situ measurement of electromagnetic field strength related to human exposure in the vicinity of base stations. The CENELEC 50492 standard requires an uncertainty assessment to be performed when extrapolation is not used to address maximum traffic. A full uncertainty analysis for the measurement methodology developed by EMSS has been performed and resulted in an expanded uncertainty of 3.8 decibel (dB).

Additional survey information, typically shown in a CENELEC 50492 report, is available from BTA on request.

For more information, contact the BTA at:

Tel: +267 395 7755

Fax: +267 395 7976

Email: [engineering@bta.org.bw](mailto:engineering@bta.org.bw)